

# Powerbor®

## POWERBOR - PB32 DRILL ORIGINAL INSTRUCTIONS



### WARNING !

When using electric power tools basic safety precautions should always be used to reduce the risk of fire, electric shock and personal injury.

Read all of these instructions before attempting to operate this product and save these instructions



Machine shown  
PB32 - without the  
safety guard for clarity.

The POWERBOR range of machines are exclusively manufactured by  
G&J Hall Ltd, Burgess Road, Sheffield, S9 3WD, England

PB32 - W18XC1054 - Revised 020113

PAGE INDEX	Page No.
Machine Specification	3
Explanation of symbols used	4
Intended use of power tool	5
Prohibited use of power tool	5
<b>Safety precautions</b>	
1 - Precautions and use of PPE.	6
2 - Special safety precautions - Magnetic Drills.	7
3 - Electrical safety	8
4 - Dust Extraction	8
5 - General safety instructions.	9-10
<b>Installation instructions</b>	
1 - Unpacking and Assembly	11
2 - Setting-up or fixing tool in a stable position.	11
3 - Connection to power supply.	11
4 - Illustrated description of functions	12
5 - Limitations on ambient conditions	13
6 - Standard Accessories	13
7 - Disassembly and transportation	13
<b>Operating instructions</b>	
1 - Setting and testing.	14
2 - Tool changing.	
Mounting of cutters into the arbor.	14
Removing the arbor and fitting the drill chuck	15
Using Twist Drills.	15
3 - Guards	16
4 - Clamping of work. (Magnet Control)	16
5 - Limits on size of work piece and type of material.	
Cutting Speeds/Materials—HSS cutters	17
Workpiece Material and size Limitations	17
6 - General instructions for use.	
Drill unit spindle control	18
Coolant system	18
Reversing of the handles	19
Normal operator position	19
Using the drill with annular cutters	20
7 - Lifting handles/transportation.	5
<b>Maintenance and servicing</b>	
1 - Regular cleaning, maintenance and lubrication.	21
2 - Servicing by manufacturer.	22
3 - Special Tools	13
4 - Blockages of chips or work piece fragments.	20

## MACHINE SPECIFICATION

### PB32

Machine Height	320mm (slide in down position)	
Machine Width	90mm (without handles)	
Machine Depth	240mm	
Stroke	160mm	
Machine Weight	12.5kg (tool and detachable parts)	
Rated Motor Power	720W	
Voltage	110V / 230V AC	
Rated Current	6.5A / 3.2A	
IP Rating	IP20	
Spindle Speed - load	380 /min	
Spindle Speed - no	550 /min	
No. of speeds	Single Speed	
FWD/REV	No	
Power Cord Length	2.5m	
Insulation Class	CLASS I	
Annular Cutter Capacity	Ø32mm	
Standard Cutting Depth	25mm (50mm with optional long Arbor)	
Twist Drill Capacity	Ø13mm (18mm with reduced shank drill)	
Tapping Capacity	N/A	
Countersink	Yes	
Chuck Type	3/4" Weldon Shank Arbor or 13mm Chuck	
Spindle Fitting	1/2" x 20 UN	
Magnet Dimensions	160mm x 85mm	
Magnet Power	60W	
Magnetic Adhesion	1000kg (measured on 25mm thick plate)	
Minimum Plate Thickness	12mm (minimum recommended)	
Sound Pressure Level	86 dBA	Uncertainty 3 dBA
Sound Power Level	99 dBA	Uncertainty 3 dBA
SPL at Operators Head	89 dBA (1.55m high x 1m distance)	Uncertainty 3 dBA
Hand-arm Vibration	Less than 2.5 m/s <sup>2</sup>	Uncertainty 1.5m/s <sup>2</sup> .

The vibration measurement was made under standard conditions in accordance with the requirements of BS EN 60129-1:2009.

The actual vibration level during use will depend on the workpiece stability/rigidity and the condition of the cutter used. These factors may increase the vibration experienced by the operator, each individual application of the tool should be assessed for the effect of these application variable factors, before exposure.

## EXPLANATION OF SYMBOLS USED

Symbol	Meaning
	Eye protection should be worn at all times when using this tool.
	Hard Hat—Head protection should be worn at all times whilst using this tool, to protect from overhead hazards
	Ear protection / Ear defenders should be worn at all times whilst using this tool, this tool exceed 85dB(A)
	Electrical enclosure - risk of electric shock.
	Read and understand the instruction manual - before operating this tool.
	Caution ! / Attention !
	Instruction Manual
	WEEE - Waste of Electrical and Electronic Equipment This tool should be disposed of as Electrical & Electronic Waste.

## INTENDED OF USE OF POWER TOOL

This power tool is intended to be used for drilling holes with annular cutters, twist drills, counterbores, countersinks and step drills in an industrial environment.

The machine is meant to be held onto a magnetisable surface using its electro-magnetic base.

The power tool should be used in a weather protected environment and be used with the accessories provided or Powerbor recommended accessories only.

The power tool can be used vertically, horizontally and upside down, provided the magnetic adhesion and work environment allow.

Cutting paste should be used rather than cutting fluid when using the machine in the upside down position to prevent ingress of fluids into the electrical system.

## PROHIBITED USE OF POWER TOOL

This power tool should NEVER be used without a ground or protective earth connection.

This power tool should NOT be used in a potentially explosive environment.

This power tool should NOT be use in a wet or humid environment where water could be drawn into the power tools cooling and ventilation system.

If the power tool is used in the upside down position, cutting fluids should not be used to prevent ingress of fluids into the electrical system, cutting paste should be used instead.

This power tool should never be positioned on a workpiece between the electrode and ground of an arc type welder. Damage to the machine will result as the welder will ground through the power tools ground or earth cable.

This power tool should not be used where the voltage is abnormally lower than the rated voltage, subject to voltage tolerances. Check the power tool rating plate, check the voltage available.


Operating on a lower than rated voltage will result in the electro magnet being at reduced power and the machine may become insecure whilst drilling.

## LIFTING HANDLES - TRANSPORTATION

When lifting the tool the lifting handles shown in the diagram on the right should be used.

The drill unit should be lowered to its lowest position for improved stability.

Under no circumstances should the motor cable be used for lifting the power tool.

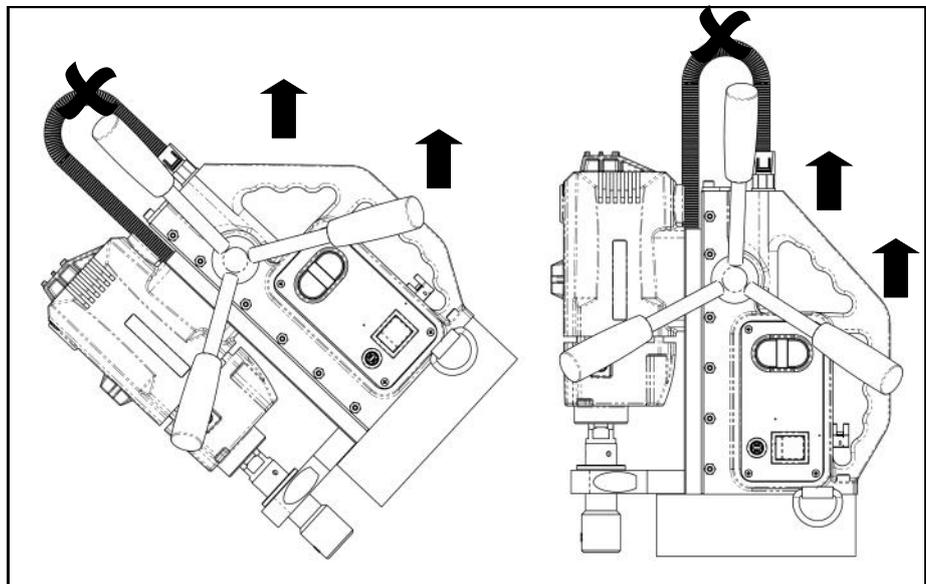

## **PERSONAL SAFETY AND USE OF PPE**

### **Attention**

Always watch what you are doing and use common sense at all times when operating power tools.

Do not use the power tool whilst tired, or under the influence of drugs, alcohol or medication.

A moment of inattention when using a power tool may result in personal injury.

### **Clothing**

Always dress appropriately, do not wear loose clothing or jewellery.

Contain long hair, keep your hair, clothing and gloves away from any moving parts.

Loose clothes, jewellery or long hair can be caught in moving parts.

### **Accidental Start-up**

Be sure all switches are in their OFF positions before plugging in the machine.

When carrying or moving tools always keep your fingers away from the switches

Plugging in a power tool with the switches in the ON position could invite accidents.

### **Intentional Start-up**

Before starting up the power tool always remove any adjusting keys or tools.

A wrench key left in a rotating part of the power tool may result in injury.

### **Over Reaching**

Never over reach when using a power tool. Always ensure you have a proper stable footing and balance at all times before operating the tool.

Proper footing and balance enables better control of the tool in case of unexpected situations.

### **Personal Protective Equipment**

Always wear eye protection.

Always wear ear protection.

Always wear head protection.

Always wear non-skid safety shoes.

Where appropriate wear a dust mask and gloves depending on the working environment.

**WORK IN A SAFE MANNER AT ALL TIMES**

## **SPECIAL SAFETY PRECAUTIONS - MAGNETIC DRILLS**

### **Safety Strap**

The electro-magnet base on this power tool can release if there is a interruption in power supply or electrical malfunction.

The safety strap provided should be used at all times to prevent the power tool from falling in the event of power failure or electrical malfunction, possibly causing injury.

The safety ratchet strap should be attached to the fixing points provided and checked for security before commencing any drilling operation.

### **Magnetic Adhesion**

The magnets strength depends on the thickness and condition of the work piece material. Always ensure that the work piece has a minimum thickness of 12mm or 1/2" to ensure there is adequate magnetic adhesion.

If the work piece is less than 12mm or 1/2" then a piece of steel plate 12mm or 1/2" in thickness and larger than the magnet footprint must be inserted to supplement the magnetic adhesion.

The surface on which the magnet is placed should be clean, flat and clear from debris or rust. The base of the magnet should be inspected to ensure it is also clean flat and clear of debris.

Always check the magnet is securely adhered to the work piece before commencing any drill operations.

Do not use other appliances on the same power receptacle, any variation in voltage cause by other appliances could result in the magnet releasing. Always us the tool on its own power receptacle.

This power tool can be used on a vertical surface or upside down provided there is sufficient magnetic adhesion, extra care should be taken when drilling vertically or upside down . When using the machine vertically or upside down it is possible hot and sharp swarf or chips may fall. Always wear appropriate personal protective equipment

### **When Cutting**

When using coolant of lubricants, ensure coolants and lubricants do not enter the drill units ventilation/cooling openings.

If the drill is used in the upside down position, use cutting paste instead of cutting fluid to prevent the possibility of fluids entering the electrical system.

When using annular cutters ensure that the slug ejected at the end of the cut will not endanger anyone in the vicinity, if working at height some form of collection device for the ejected slug may be necessary.

Care should be taken with the ejected slug, this will be both hot and sharp, gloves should be worn when handling the slug.

## **ELECTRICAL SAFETY**

### **Earthing / Grounding.**

This power tool requires a ground or earth connection.

The power tool must be plugged into an outlet properly installed and grounded or earthed in accordance with all local codes and regulations.

Never remove or tamper with the ground or earth prong in any way.

Do not use adaptor plugs.

If the tool should electrically malfunction or breakdown, grounding or earthing will provide a low resistance path to carry harmful electricity away from the user.

### **Power Cord**

Never carry the power tool by its power cord or electrical hose.

Keep power cords away from heat, oil and sharp edges.

Never pull the power cord to disconnect it from the receptacle.

Always carry the power tool properly with the carrying handles provided.

Periodically inspect the power cord for damage,

If any damage is found the power tool should not be used until the damage has been repaired by a qualified electrician.

A damaged power cord will increase the risk of electric shock.

### **Using the Power Tool Outside**

Do not expose the power tool to rain or wet conditions, water entering the power tool will increase the risk of electric shock.

When operating the power tools outside, if required, an extension cord rated for outdoor use should be used.

These extension cords are rated for outdoor use and reduce the risk of electric shock.

### **Electrical Enclosure**

The electrical components on this power tool are housed within the main body casting, this and the side panels of the main body create an electrical enclosure.

The panels should not be removed except by a suitable trained or qualified electrician.

## **DUST EXTRACTION**

This tool is intended for drill holes in ferrous metals, if using on materials such as cast iron where dust might be created, suitable dust extraction should be used.

This is both to protect the operator and to protect the motor inlet from ingress of harmful dust particles.

Operators should wear suitable dust masks if dust is created whilst working.

## GENERAL SAFETY

- 1 - Keep work area clear  
Cluttered areas and benches invite injuries.
- 2 - Consider work area environment  
Do not expose tools to rain.  
Do not use tools in damp or wet locations.  
Keep work area well lit.  
Do not use tools in the presence of flammable liquids or gases.
- 3 - Guard against electric shock  
Avoid body contact with earthed or grounded surfaces  
(e.g. pipes, radiators, ranges, refrigerators).
- 4 - Keep other persons away  
Do not let persons, especially children, not involved in the work touch the tool or the extension cord and keep them away from the work area.
- 5 - Store idle tools  
When not in use, tools should be stored in a dry locked-up place, out of reach of children.
- 6 - Do not force the tool  
It will do the job better and safer at the rate for which it was intended.
- 7 - Use the right tool  
Do not force small tools to do the job of a heavy duty tool.  
Do not use tools for purposes not intended; for example do not use circular saws to cut tree limbs or logs.
- 8 - Dress properly  
Do not wear loose clothing or jewellery, they can be caught in moving parts.  
Non-skid footwear is recommended when working outdoors.  
Wear protective hair covering to contain long hair.
- 9 - Use protective equipment  
Use safety glasses.  
Use face or dust mask if working operations create dust.
- 10 - Connect dust extraction equipment  
If the tool is provided for the connection of dust extraction and collecting equipment, ensure these are connected and properly used.
- 11 - Do not abuse the cord  
Never yank the cord to disconnect it from the socket. Keep the cord away from heat, oil and sharp edges.
- 12 - Secure work  
Where possible use clamps or a vice to hold the work. It is safer than using your hand.
- 13 - Do not overreach  
Keep proper footing and balance at all times.

## GENERAL SAFETY - CONT.

### 14 - Maintain tools with care

Keep cutting tools sharp and clean for better and safer performance.

Follow instruction for lubricating and changing accessories.

Inspect tool cords periodically and if damaged have them repaired by an authorized service facility.

Inspect extension cords periodically and replace if damaged. Keep handles dry, clean and free from oil and grease

### 15 - Disconnect tools

When not in use, before servicing and when changing accessories such as blades, bits and cutters, disconnect tools from the power supply.

### 16 - Remove adjusting keys and wrenches

Form the habit of checking to see that keys and adjusting wrenches are removed from the tool before turning it on.

### 17 - Avoid unintentional starting

Ensure switch is in "off" position when plugging in.

### 18 - Use outdoor extension leads

When the tool is used outdoors, use only extension cords intended for outdoor use and so marked.

### 19 - Stay alert

Watch what you are doing, use common sense and do not operate the tool when you are tired.

### 20 - Check damaged parts

Before further use of tool, it should be carefully checked to determine that it will operate properly and perform its intended function.

Check for alignment of moving parts, binding of moving parts, breakage of parts, mounting and any other conditions that may affect its operation.

A guard or other part that is damaged should be properly repaired or replaced by an authorized service centre unless otherwise indicated in this instruction manual.

Have defective switches replaced by an authorized service centre.

Do not use the tool if the switch does not turn it on and off.

### 21 - Warning

The use of any accessory or attachment other than one recommended in this instruction manual may present a risk of personal injury.

### 22 - Have your tool repaired by a qualified person

This electric tool complies with the relevant safety rules. Repairs should only be carried out by qualified persons using original spare parts, otherwise this may result in considerable danger to the user.

## UNPACKING AND ASSEMBLY

The Powerbor PB32 comes in a rugged blow moulded carrying case before first use:-

1. Remove the machine from the carrying case. (Note:- 12.5kg weight)
2. Fit the three screw in handles to the pinion shaft.
3. Fit the safety guard as shown in the instructions, see "Using the safety guard"
4. Fit the arbor, as detailed in the instructions under "Fitting the Drill Chuck / Arbor"

## SETTING UP THE TOOL

Before using the tool please ensure you have read the sections on the intended and prohibited of use of the machine.

The machine should only be used for hole drilling whilst attached to the work piece by the electro-magnetic base.

This machine is intended for use at any angle, but only if the electro-magnet is in full working order and has sufficient hold on the work piece material.

The safety strap should be attached in case of power failure or machine malfunction.

The safety strap should NOT be used as an alternative to the magnet for clamping purposes.

Always ensure the strap is correctly fitted and the machine is secure BEFORE starting

## CONNECTION TO THE POWER SUPPLY

Connection to the power supply is by 2.5m cable and plug.

For the 230V machine this is by a 3 pin plug with earth connection.  
For the 110V machine this is via a CEE type 2pin+earth plug.

The BS1363 plug version is fused, the European Schuko type plug is not fused.

This tool is CLASS I insulation and MUST be earthed, any power socket the tool is connected to must have an earth.

Before the power cord is connected the magnet switch should be in the OFF position.



The power cord assembly is a custom terminated one, replacement should only be carried out by a qualified electrician. Only use the replacement parts listed below.

Power cord part numbers:-

230V ~ BS Plug	18X503
230V ~ EU Plug	18X503/EU (Shuko / VDE)
230V ~ AU Plug	18X503/AU
110V ~ 2P+E	18Y181

For connection information, should the power cord need to be replaced, please refer to the wiring diagram in this manual or the connection label inside the rear panel of the power tool.

# ILLUSTRATED DESCRIPTION OF FUNCTIONS

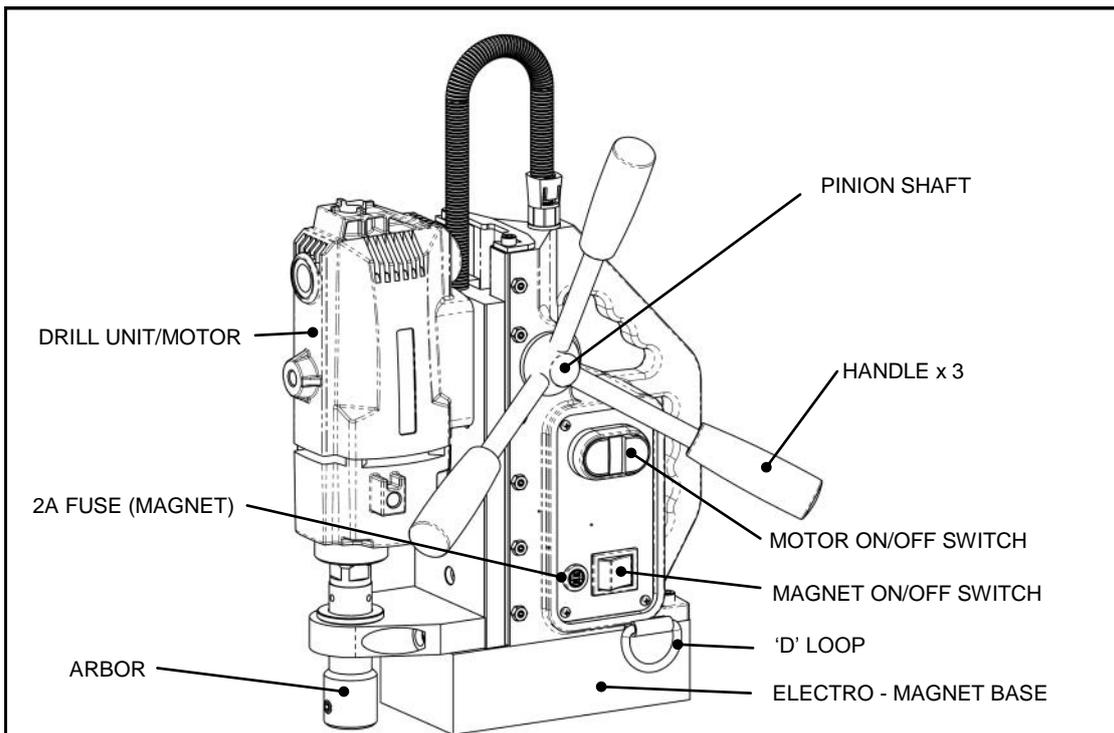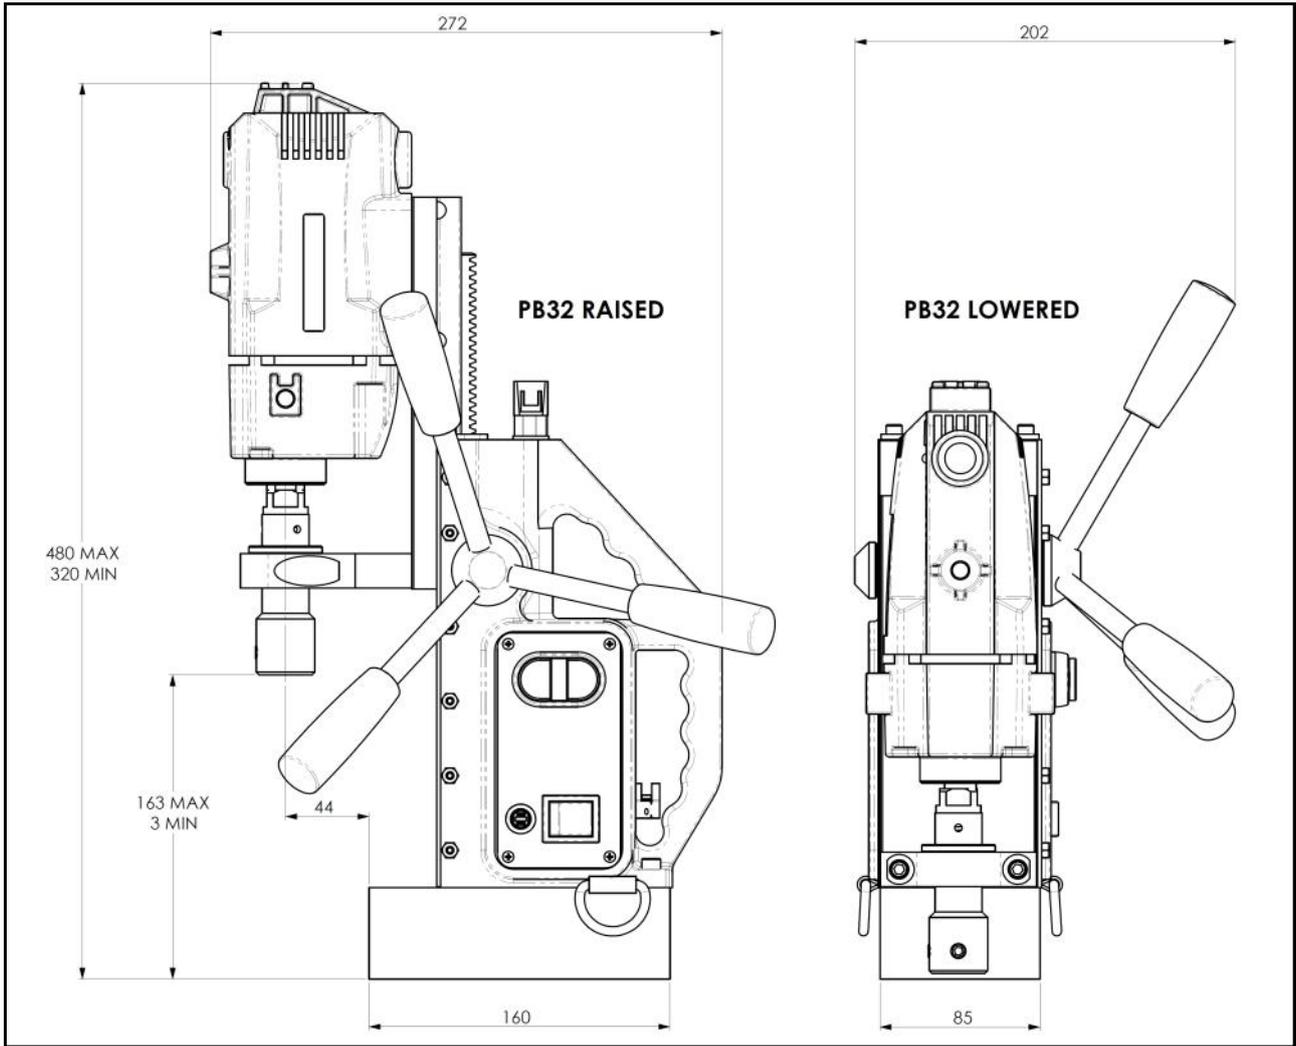

## LIMITATIONS ON AMBIENT CONDITIONS

This power tool is has an ingress protection rating of IP20, it should not be used in dusty or damp environments.

The power tool should be used in a weather protected environment.

Precautions should be taken to ensure dust does not enter the ventilation system of the power tool causing clogging and overheating.

Power tools produce sparks that may ignite flammable substances such as gases, flammable liquids or dust.

Do not operate this power tool in a potentially explosive environment.

Ambient temperatures of  $>45^{\circ}\text{C}$  should be avoided.

## STANDARD ACCESSORIES

The PB32 is supplied in a rugged carrying case with the following as standard :-

- 3/4" Weldon shank arbor (25mm cut depth)
- Safety ratchet strap
- Safety guard
- 250ml bottle and nozzle - provide for use with coolant
- Allen key set
- 13mm drill chuck and key

## DISASSEMBLY & TRANSPORTATION

When the machine is not in use it should be stored in the carrying case provided.

Any cutters should be removed after use.

The drill unit should be wound down into a low position.

The three pinion handles need to be removed before placing the tool in the case.

Any additional tools or accessories should be stored in the case.

Make sure the case is securely closed and latches are secure before lifting the carrying case.

## SPECIAL TOOLS

All tools required for the safe operation and maintenance of this power tools are provided within the standard accessories, no additional tools should be required.

## SETTING AND TESTING - USING THE SAFETY STRAP

A ratchet type safety strap is provided.

The power tool has 2 x 'D' loop rings to allow the hooks on the safety strap to be attached securely.



Always ensure the strap is correctly fitted and the machine is secure BEFORE starting the motor unit.

The safety strap is used to reduce the risk of injury in the case of a power supply or electrical malfunction.

The strap will hold the power tool if the electro-magnet loses its magnetic adhesion.

If the strap becomes damaged or lost, it must be replaced BEFORE using the power tool.

DO NOT use the safety strap as an alternative clamping method, the electro-magnet should have good magnetic adhesion at all times whilst using this power tool.

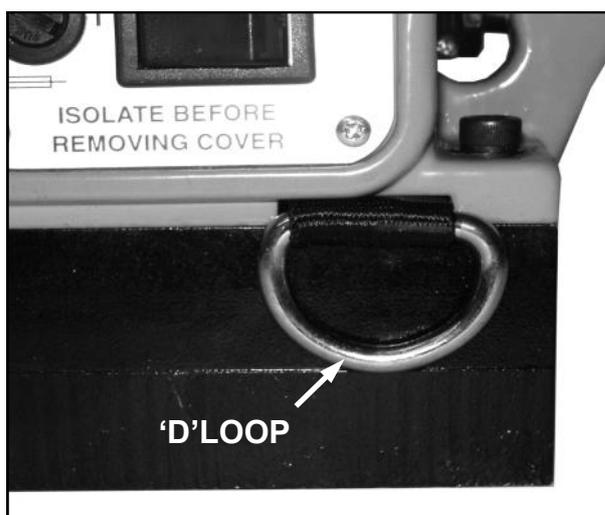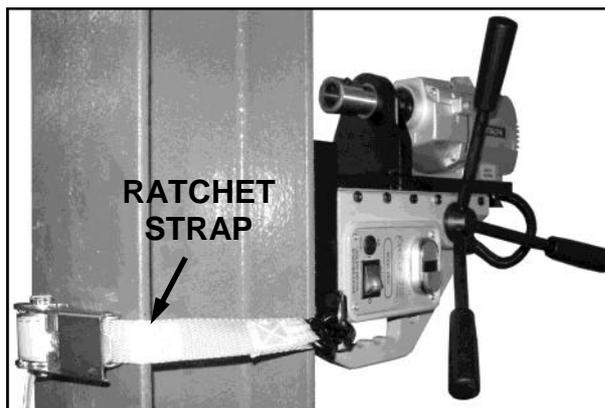

## MOUNTING CUTTERS INTO THE ARBOR

The holder for the cutting tool is known as the arbor. The arbor is designed to accept Powerbor 3/4" Weldon shank annular cutters.

The Powerbor annular cutters normally have two flats disposed at 90° to each other.


To mount the cutter.

First ensure the ejector pin is in place.

Align the flats with the two fixing screws.

Push the cutter up into the arbor until it stops.

Tighten the two fixing screws onto the cutter flats with the hex keys supplied.

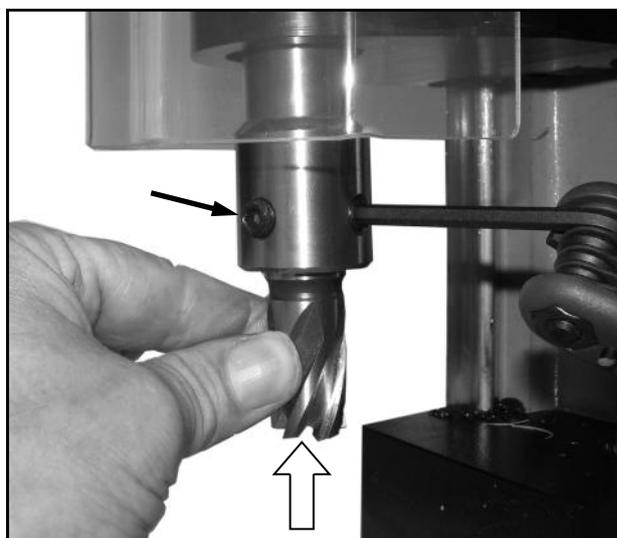

## FITTING THE DRILL CHUCK SUPPLIED

To replace the arbor (A) with the drill chuck supplied first remove the arbor.

To do this, using the spanners supplied, place one spanner on the flats of the drill output shaft.

Turn clockwise (as viewed from above) until the spanner meets the dovetail slide.

Place the the second spanner on the flats of the arbor, apply pressure, again clockwise as viewed from above.

If possible the magnet can be used to hold the machine whilst removing the arbor.


If the arbor is tight the spanner on the arbor flats can be tapped with a soft mallet.

Once the arbor is unscrewed the arbor support bracket (B) needs to be removed. This is accomplished by removing the two hexagon socket head cap screws.

To fit the drill chuck simply screw it into place on the spindle nose.

A special left handed screw is provided to hold the chuck.

Replacement of the arbor is a reversal of the procedure above.

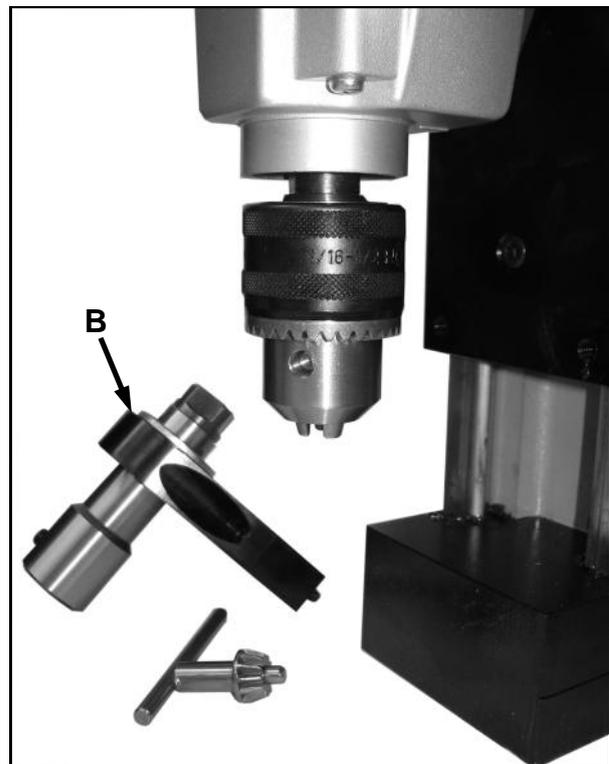

## USING TWIST DRILLS

Twist drills can be used with the PB32.

To accommodate twist drills, or any plain shank cutting tool, the PB32 is supplied as standard with a 13mm drill chuck and key.

The drill chuck takes standard parallel shank twist drills of up to 1.5 - 13mm, and if required reduced shank drills of up to 18mm can be used.



## SAFETY GUARD


A safety guard is supplied with this power tool, it should be attached **BEFORE** using the power tool.

The guard is attached at 3 points, by button head screws to the motor. The nylon washer should be closest to the guard with the spring washer between the nylon washer and the screw head.

The screws should be tightened just enough to allow the spring washers to hold the guard up.

The guard has approximately 50mm of travel which is adequate standard length cutters.

The guard should be adjusted so it is able to slide with light pressure.

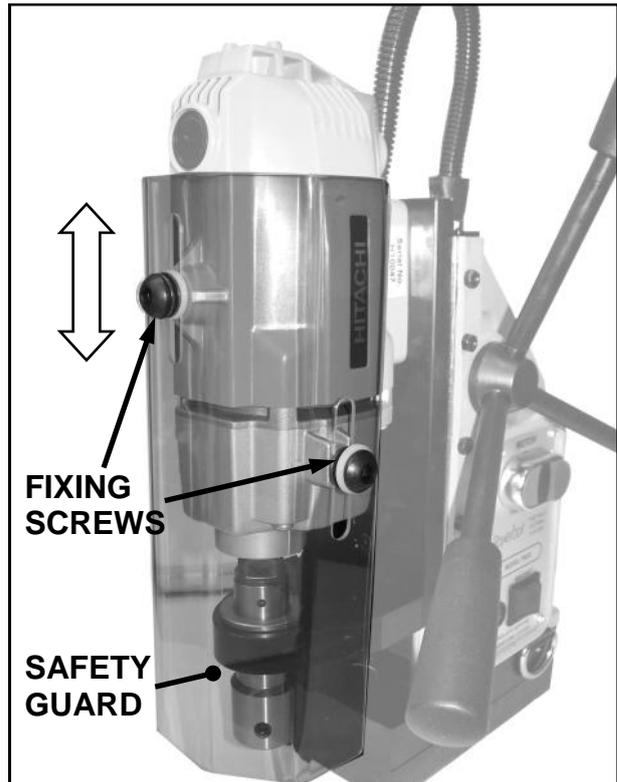

## CLAMPING - MAGNET CONTROL

An electro-magnet is used for clamping the tool onto the workpiece.

The magnet is controlled by the magnet switch (F) located at the bottom of the control panel.

'O' indicates magnet OFF 'I' indicates magnet ON.


Ensure the magnet switch is OFF before connecting the power supply.

Ensure the magnet is clean and free from debris and that the machine is on a flat clean ferrous surface of the required minimum thickness (12mm).

To switch the magnet ON, press the switch to the 'I' position, the switch will illuminate to indicate there is a power supply to the machine.

The security of the magnet should always be physically checked **BEFORE** starting the drill unit.

The magnet is protected by a 20mm 2A fast acting fuse (G).

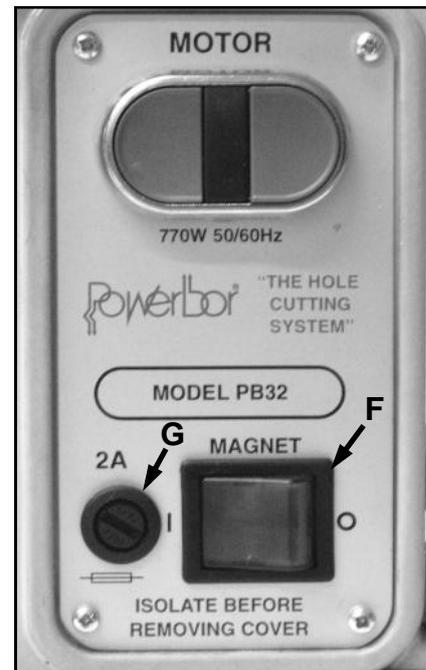

## CUTTING SPEEDS/MATERIALS—HSS CUTTERS


The PB32 is a single speed drill unit with a nominal load speed of 380 rev/min. Under load the PB32 will regulate its speed depending on the load applied.

ie: a small cutter will run faster than a larger cutter (if the same feed rate is applied)

The PB32 has the optimum power / torque / spindle speed for HSS annular cutters in the range Ø12mm to Ø32mm, cutting EN10025 S235J steel or its equivalent.

The PB32 can also be used on other materials such as high tensile steel and stainless steel if the appropriate speed for the material to be cut is selected.

Cutting Speeds—suggested speed rates for varying cutter diameters / materials

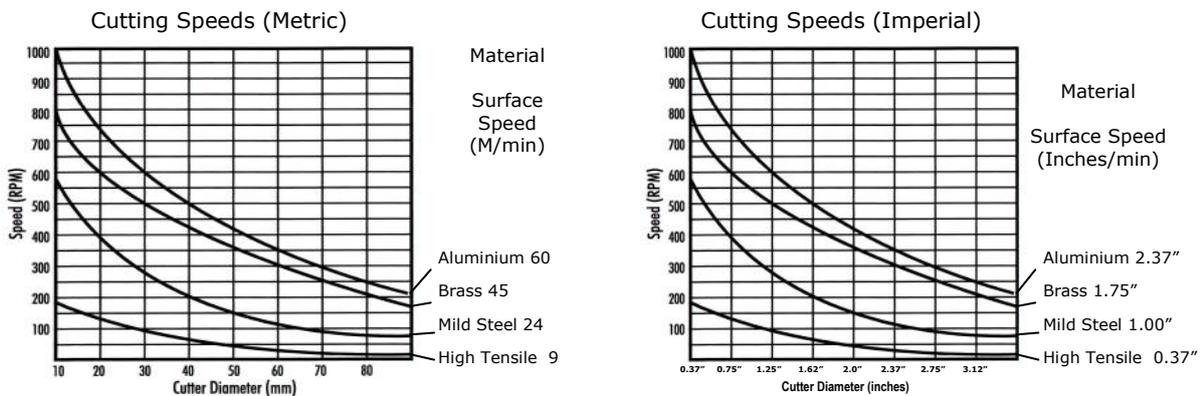

## WORKPIECE MATERIAL AND SIZE LIMITATIONS - MAGNET

The electro - magnet clamping force is measured as the pull off load when clamped on a steel plate (EN10025 S235J or its equivalent) of 25mm thickness, flat with a good surface and free from rust and debris.

For any other workpiece material the clamping force will be different, any difference in workpiece thickness and the clamping force will deviate.

The minimum recommended plate thickness for the electro-magnet is 12mm thick.

If the workpiece is thinner than recommended then an additional plate, made of suitable material should be added by clamping to the workpiece, this will help the electro-magnet become more secure.

BEFORE using the drill always ensure the magnet is held onto the work piece securely.

## OPERATION - SPINDLE - START / STOP

The drill unit or “motor” is controlled by a twin push button switch (H) at the top of the control panel.


The green button is ON the red button is OFF.

The green button is flush with the surrounding bezel.  
The red button is raised above the surrounding bezel.  
This is to prevent inadvertent operation of the drill unit.

The motor will not operate unless the magnet is switched ON first.

BEFORE starting the motor, the security of the magnet should be physically checked, if any movement is possible this should be rectified BEFORE using the drill.

The motor control has an under-voltage relay, if the power is interrupted the motor will stop and will not restart when the power is resumed until the motor control is operated again.

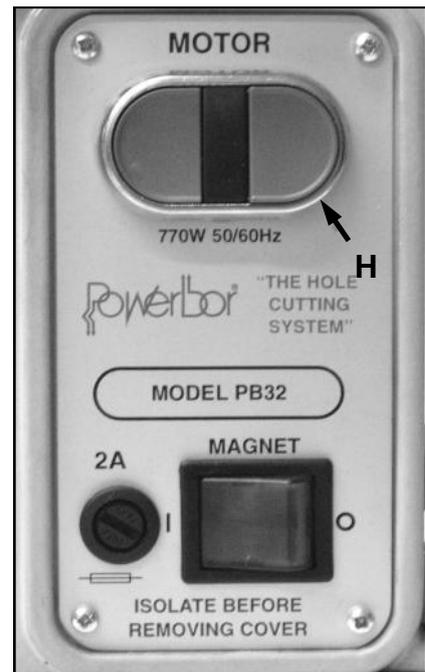

## OPTIONAL COOLANT SYSTEM

The arbor supplied with PB32 has an internal reservoir for coolant built in.

If additional coolant capacity is required, an external coolant system which feeds through the arbor is available.

This system must be specified at time of purchase, as the external coolant system can not be retro fitted to existing machines.

## OPERATION - REVERSING OF THE HANDLES

The three handles (C) which raise and lower the drill unit are attached to the pinion shaft (D).

These handles and the pinion shaft itself can be turned around so the handles can be used on each side of the machine. This is useful if access is limited on one side of the machine because of the machines location.

The handles are normally mounted on the same side as the controls, if they need to be reversed the following procedure should be used.



First, the drill unit and its slide should either be supported or put into its lowest position to prevent the risk of it falling when the pinion is disengaged.

The hexagon head cap screw in the end of the pinion shaft end cap (E) should be unscrewed.

The pinion shaft end cap can then be removed, the pinion shaft and handle assembly can be withdrawn.

The pinion shaft and handle assembly can then be mounted on the opposite side of the machine, taking care to ensure the pinion gear teeth engage with the rack teeth.

The pinion shaft end cap and its hexagon head cap screw should then be replaced and re-tightened.

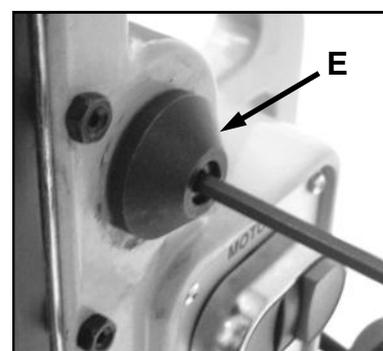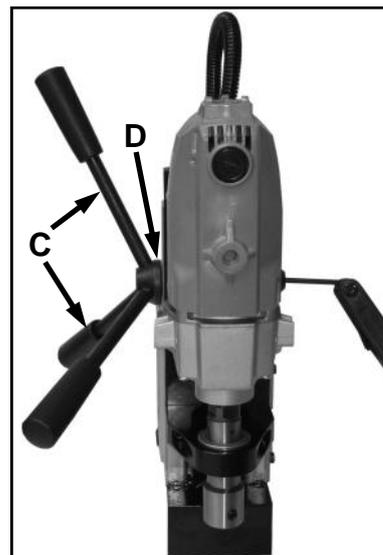

## OPERATION - NORMAL OPERATOR POSITION

The normal operator position is as shown in the image on the right, in general it is best to use the machine from in front of the control panel so that all the operator controls are visible and easily accessed.

There are occasions with this type of machine that it is used horizontally or even upside down. Extra care should be taken in these circumstances and access to the machine controls should be maintained.

The pinion shaft can be reversed on this type of machine to allow the drill better access in confined spaces. When the handles are reversed, again the operator should still have full access to the control panel before using the machine.



## **OPERATION - USING THE DRILL WITH ANNULAR CUTTERS**

Insert the correct pilot pin into the pilot pin hole through the shank of the cutter.

Mount the cutter in the tool holder (arbor) of the machine as described in previous chapters, ensuring the cutter is secure and correctly fitted.

Position the machine on the work piece ensuring the magnet is on a flat clean ferrous surface and the work piece is not below the minimum recommended thickness.

Use the pilot pin to align the centre of the cutter to the desired hole position.

Switch on the magnet and physically check the machine is securely adhered to the work piece.

Once in position, attach the safety strap, if the magnetic adhesion fails for some reason the safety strap will reduce movement of the machine.

Apply cutting fluid through the small holes in the arbor, the arbor has a small reservoir for coolant which is fed down through the central pin hole to the cutter. The use of cutting fluid will enhance the quality of the cut and prolong the life of the cutter.

Lower the safety guard provided.

Switch on the drill motor, feed the cutter down by using the three handles provided. Proceed with caution, apply pressure gradually until the cutter has formed a groove of approx 3mm (1/8"). Once a groove is established the pressure can be increased.

DO NOT apply excessive pressure, if excessive pressure is required it is a sign the cutter may be worn, continuing to use a worn cutter will result in damage to the drill motor.

If the drill motor slows significantly under load ease off the downward pressure.

On deep holes it may be necessary to withdraw the cutter to remove swarf and to apply more cutting fluid.

A cutter in good condition will need only moderate feed pressure and will produce continuous chips or swarf. Broken chips or swarf indicate a cutter or material problem, so care should be taken.

## **OPERATION - BLOCKAGES OF CHIPS AND WORKPIECE FRAGMENTS**

If excessive swarf builds up during the cut it may be necessary to withdraw the cutter to remove the swarf, care should be taken as the swarf will be both hot and sharp.

As the cutter begins to break through, the feed pressure should be reduced slightly.

When the cutter breaks through, a slug of material at the centre of the cut will be ejected. This will be both hot and sharp. Care should be taken when handling the slug.

Care should be taken that the ejection slug is safe and can not injure anyone in the vicinity, the slug should be prevented from falling where possible.

## MAINTENANCE - GENERAL

To keep this machine in a safe working condition regular certain maintenance is required.

1. The gib strip on the dovetail slide must be adjusted to eliminate any free play.
2. The dovetail slides will need to be lubricated with oil periodically.
3. The magnetic base should be inspected for damage on its magnetic surface or for any damage to the resin, any damage should be repaired before using the drill.
4. A monthly inspection of the carbon brushes is recommended, excessive wear could lead to motor damage or malfunction.

## MAINTENANCE - REPLACING BRUSHES


The carbon brushes (M) can be removed by simply unscrewing the brush cap (L).

The brush has a spring and metal cap attached, simply withdraw the brush to inspect or replace it.


When replacing the brush, slide it into the brush holder, make sure the metal cap of the brush seats in the recess on the brush cap, then screw the brush cap home.

Always use genuine replacement parts.

The brushes on this drill unit have an auto stop feature, when the brush reaches its wear limit to motor will stop until the brushes are replaced

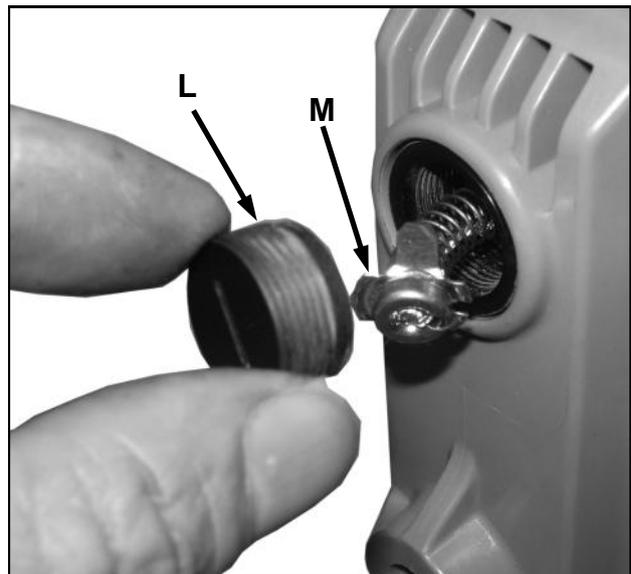


## ACCESSORIES

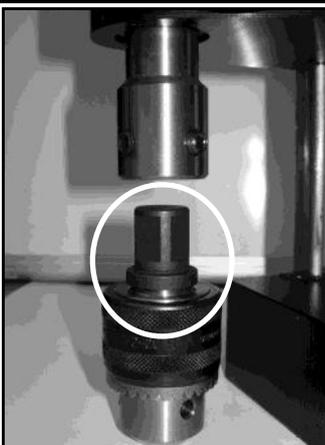

18Y170  
CHUCK ADAPTOR

This allows a drill chuck to be quickly placed into the arbor of the machine.

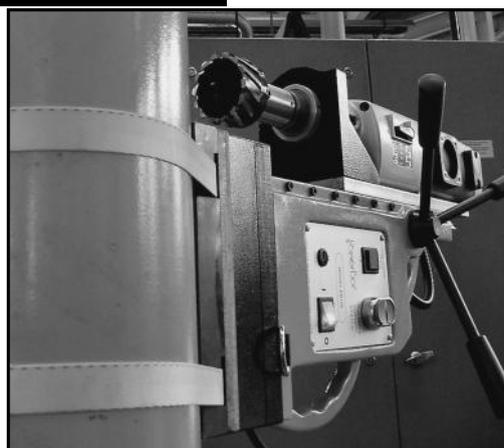

18YPIPE PIPE CLAMP

This allows the drill to be mounted on a pipe or cylindrical object, the magnet attaches to the "saddle" so the material of the workpiece does not need to be magnetic.

## MAINTENANCE - TOOL USE AND CARE

Always ensure the work piece is secure and stable before attempting to work on it.

Do not force the tool, always use the correct type of cutting tool for your application and use it at the rate it was designed to work at.

Do not use the power tool if the power switch does not turn it on or off, any tool which can not be turned on or off with the switch is dangerous and must be repaired before use.

Always disconnect the plug from the power supply before making any adjustments, changing accessories or storing the tool. This will prevent the risk of the starting the tool accidentally.

Always store tools not in use out of reach of children and untrained persons. Tools are dangerous in the hands of an untrained user.

Maintain all cutting tools with care, keep them sharp and clean, properly maintained tools with sharp edges are less likely to bind and will be easier to control.

Do not operate the power tool with dull or damaged cutting tools, this may overload the motor.

Check the power tools periodically for misalignment or binding of moving parts, also broken parts or any other condition that may affect the tools operation. If damaged have the tool serviced before using, Poorly maintained tools can cause accidents.

Use only Powerbor recommended accessories, accessories made for other power tools may not be suitable and could become hazardous when used.

## SERVICE

Only trained repair personnel should perform tool service. Service or maintenance performed by untrained personnel could result in a risk of injury.

When servicing the power tool, only use identical replacement parts, pay attention to the power tools voltage rating and model number to ensure the correct replacement parts are specified.



## WARRANTY


### POWERBOR WARRANTY STATEMENT

Powerbor warrants its magnetic drills for one (1) year from the date of purchase against defects due to faulty material or workmanship and will repair or replace (at its option) without charge, any items returned. This warranty is void if the item has been damaged by accident or unreasonable use, neglect, improper service or other causes not arising out of defects in material workmanship. No other expressed warranty is given or authorised. Powerbor disclaims any implied warranty of merchantability or fitness for any period beyond the expressed warranty, and shall not be liable for incidental or consequential damages. To obtain warranty service, return the item(s) to your nearest factory authorised repair centre.

**This warranty is on lieu of any other warranty, expressed or implied, including any warranty of merchantability or fitness for a particular purpose.**

# PB32 WIRING DIAGRAMS

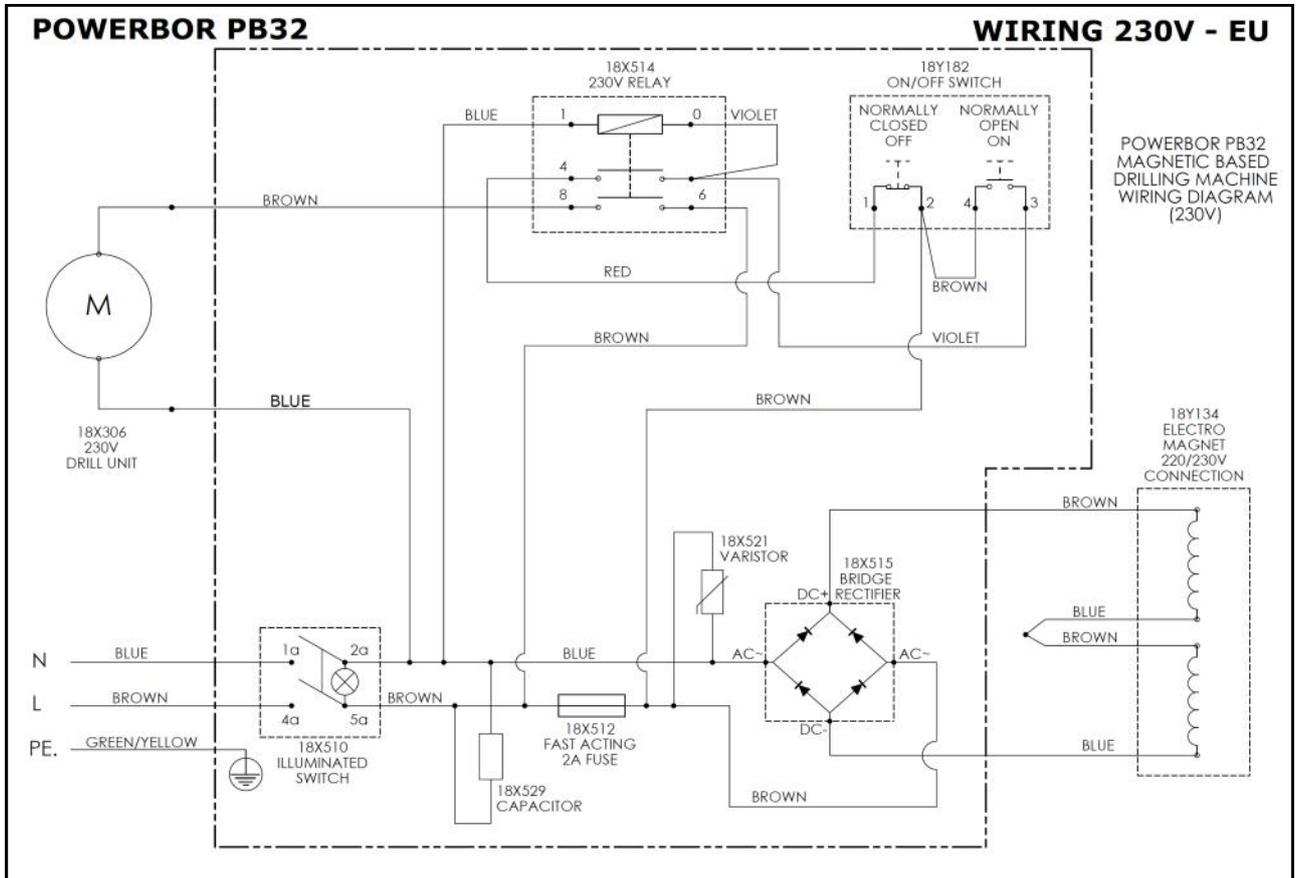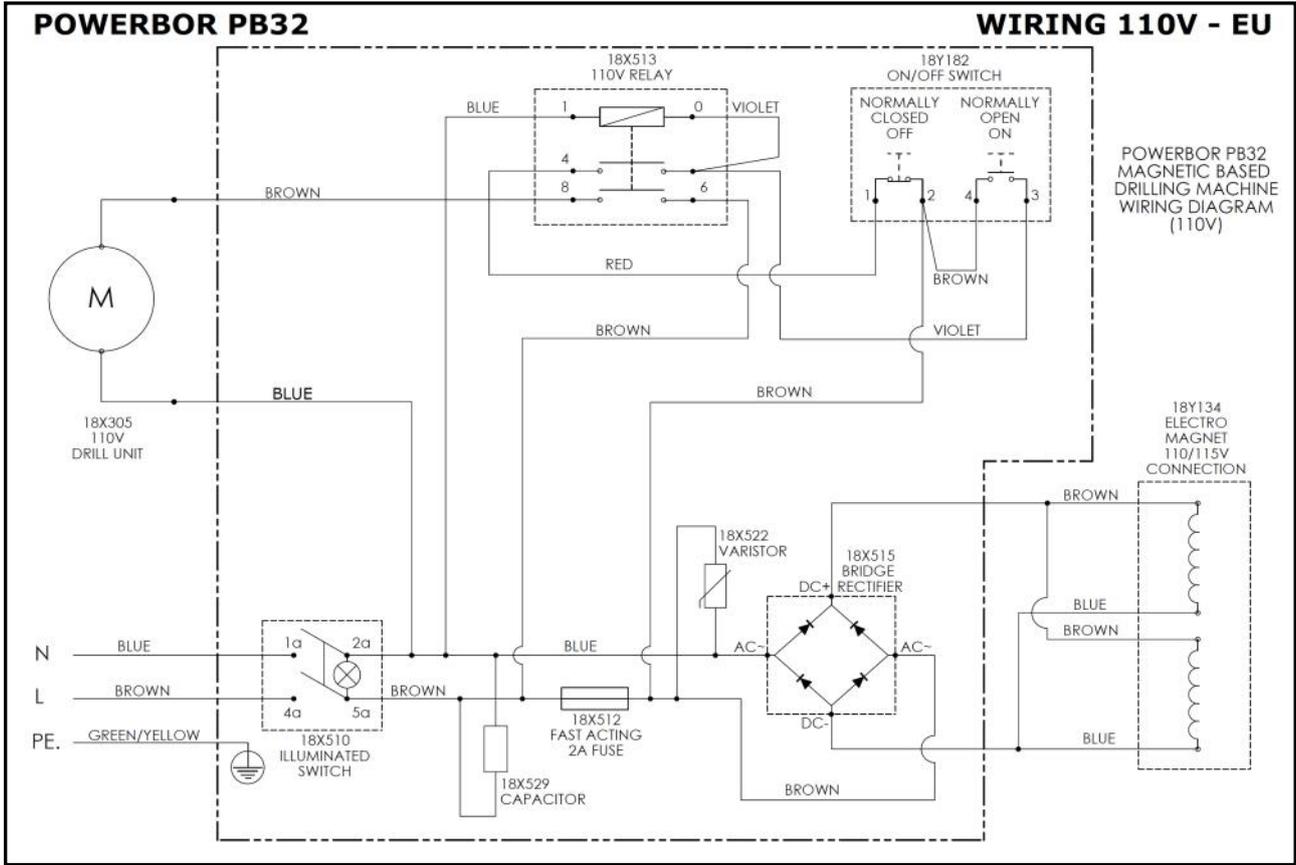


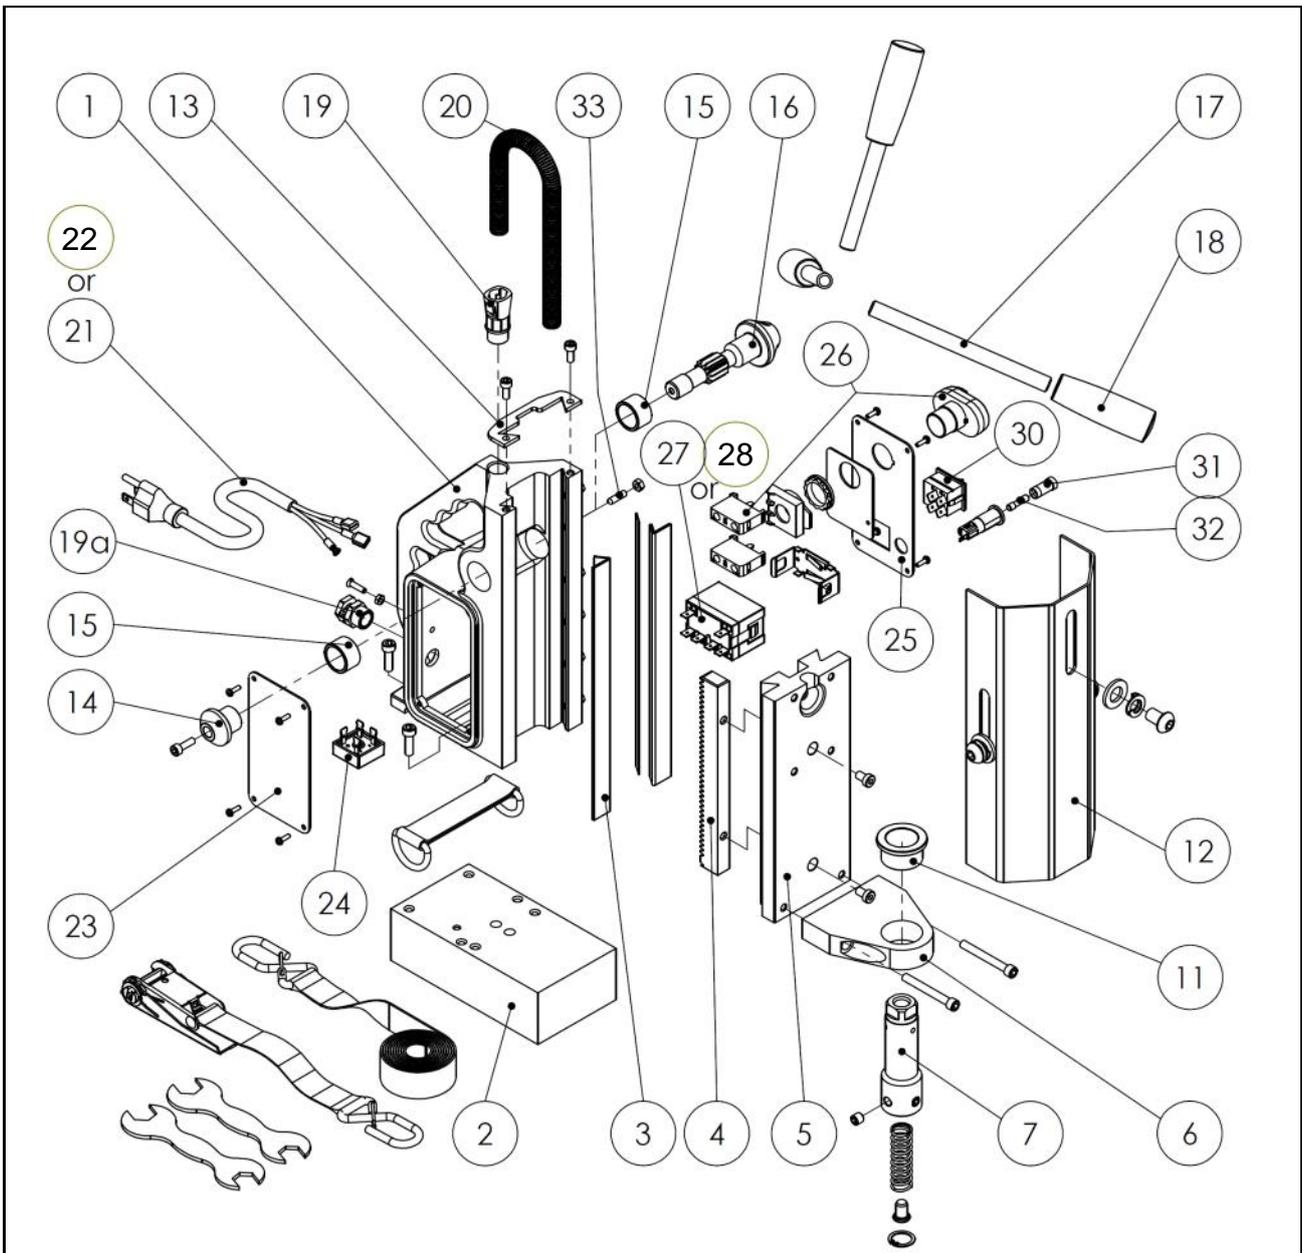

ITEM	Part No.	Description
1	18Y138	MAIN BODY CASTING
2	18Y134	ELECTRO-MAGNET BASE
3	18X312	BRASS GUIDES (PAIR)
4	18Y140	MACHINE RACK
5	18X304	DOVETAIL SLIDE
6	18Y141	ARBOR SUPPORT BRACKET
7	18Y130	ARBOR ASSEMBLY (1/2" X 20 UN)
8	18X321	ARBOR SPRING
9	18X323	ARBOR PISTON
10	18X206	INTERNAL CIRCLIP
11	18X309	SPINDLE BUSH
12	18Y143	SAFETY GUARD
13	18X311	RETAINING BRACKET
14	18X524	PINION END CAP
15	18X502	PINION BUSH
16	18Y144	PINION SHAFT
17	18X718	HANDLE (12mm)
18	18X520	KNOB (12mm)
17+18	18Y145	HANDLE/KNOB COMPLETE


ITEM	Part No.	Description
19a	18X430	CABLE GLAND (CORD GRIP)
19	18X519/A	CONDUIT GLAND
20	18Y180	CONDUIT LEAD
21	18Y181	MAINS CABLE 110V (2P+E)
22	18X503	MAINS CABLE 230V (UK)
23	18X1028	REAR PANEL
24	18X515	RECTIFIER UNIT
25	18X1024	CONTROL PANEL
26	18Y182	START/STOP SWITCH
27	18X513	POWER RELAY 110V
28	18X514	POWER RELAY 230V
30	18X510	MAGNET SWITCH (110V & 230V)
31	18X511	FUSE HOLDER
32	18X512	2A FUSE
33	18X224	M5 X 18 CONE POINT SCREW
34	18X205	M8 X 8 GRUB SCREW
35	18X330	PLASTIC CASE
36	18Y170	CHUCK ADAPTOR
37*	18Y136/110	CONTROL PANEL COMPLETE - 110V
37*	18Y136/230	CONTROL PANEL COMPLETE - 230V

## PB32 ARBOR

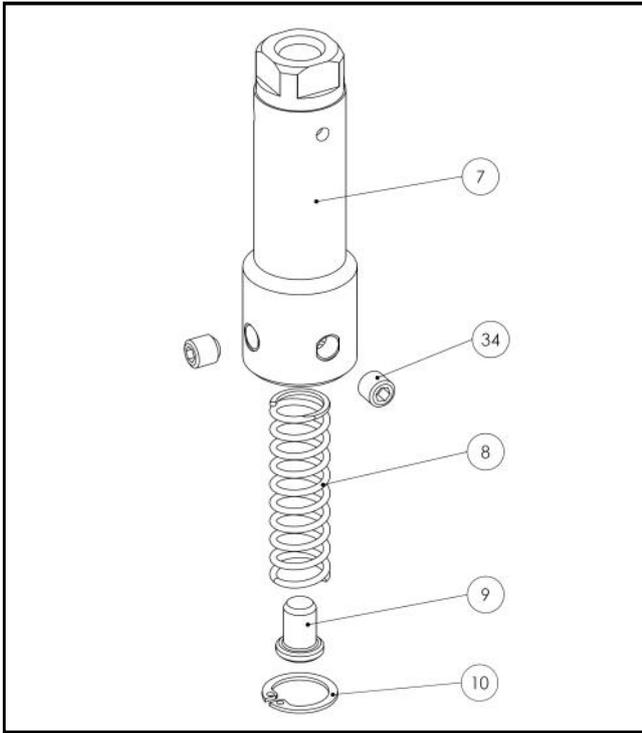


ITEM	Part No.	Description
7	18Y130	ARBOR BODY (1/2" X 20 UN)
8	18X321	ARBOR SPRING
9	18X323	ARBOR PISTON
10	18X206	3/4" INTERNAL CIRCLIP
34	18X205	M8 x 8 SOCKET SCREW

## PB32 SAFETY STRAPS

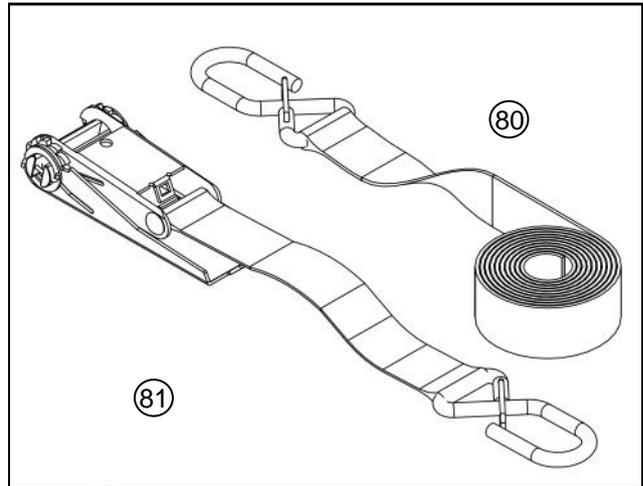


Item	Part No.	Description
80	18X535	HOOK STRAP ASSEMBLY
81	18X533	RATCHET STRAP ASSEMBLY

## PB32 DRILL GUARD

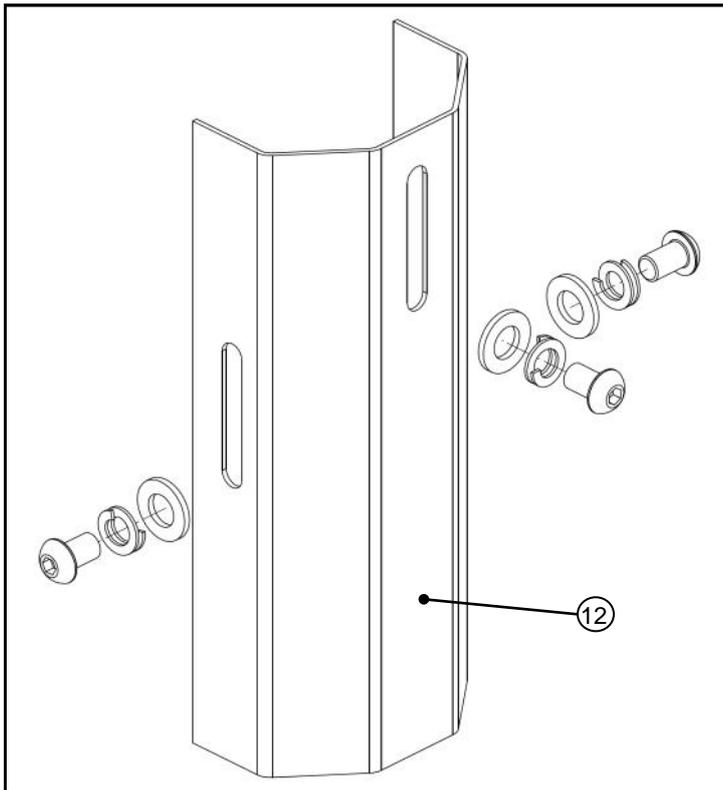

Item	Part No.	Description
12	18Y143	DRILL GUARD

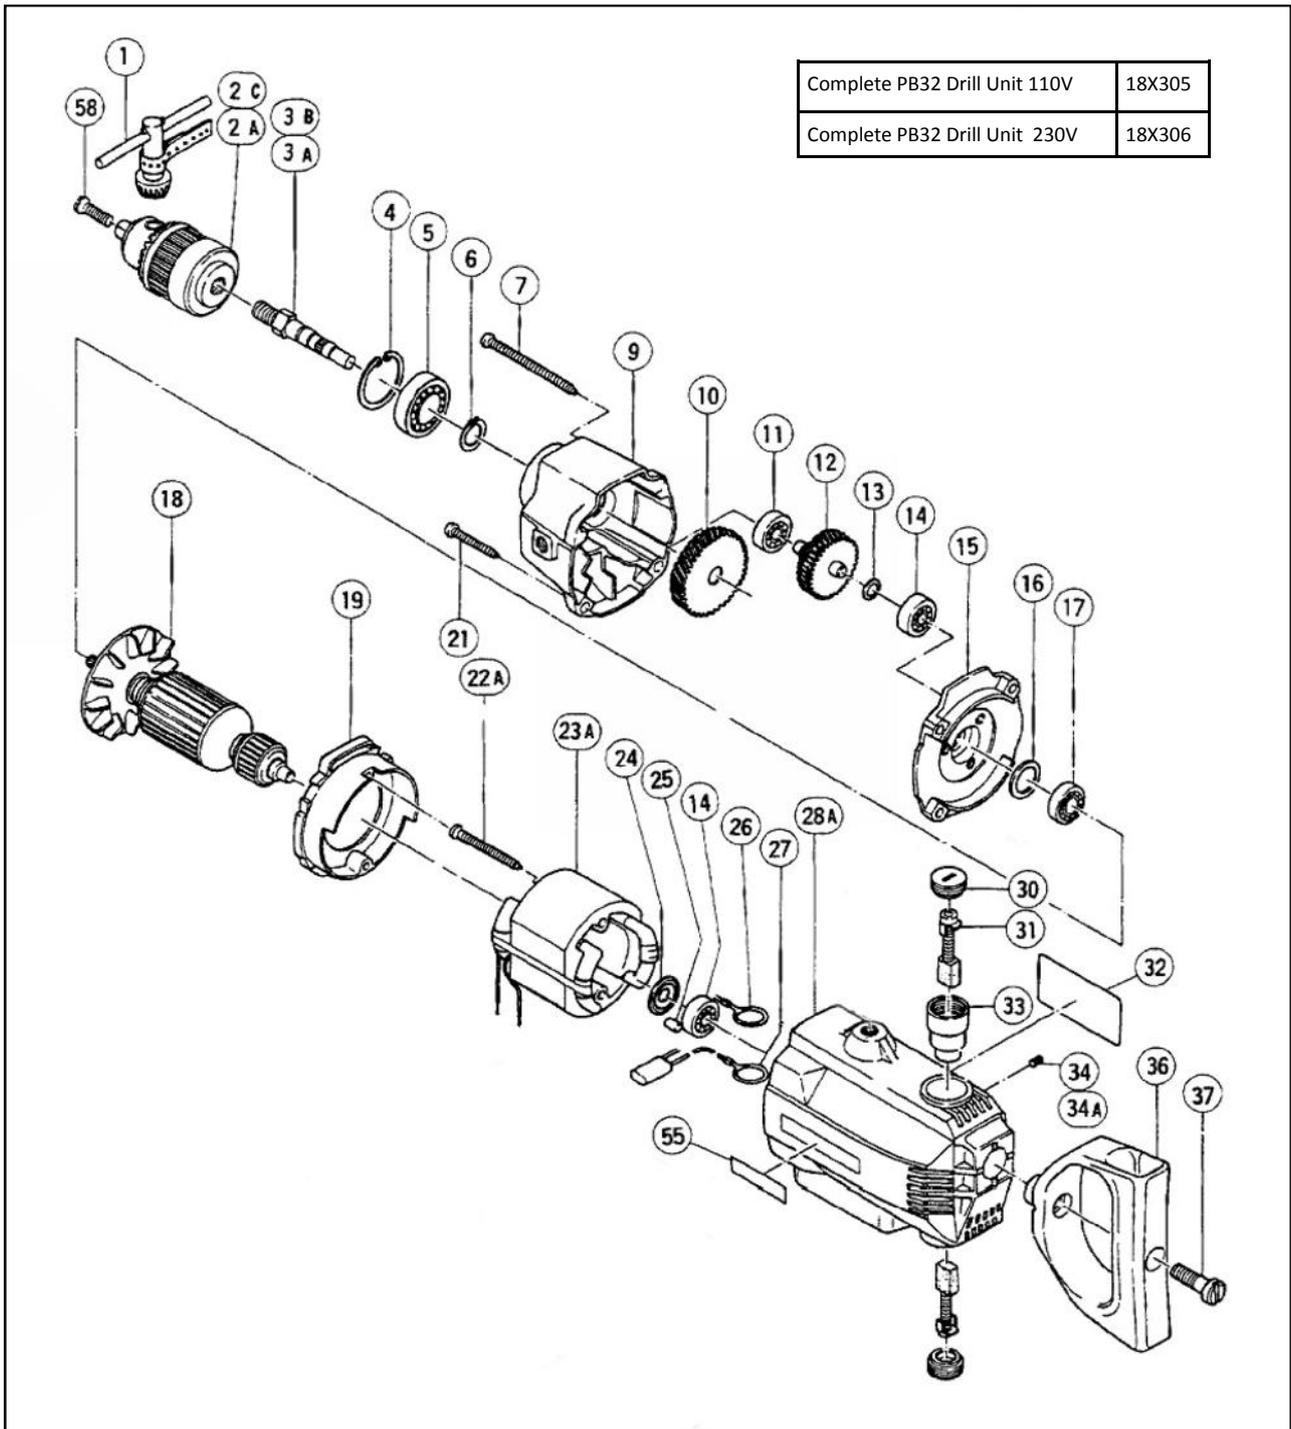

## PB32 MOTOR - PARTS LIST

Item	Part Number	Description
1	18ZA01	CHUCK WRENCH - HITACHI 930-515
2b	18ZA02B	DRILL CHUCK (13 VLR)(SUPPLY WITH 18ZA01) - HITACHI 950-275
3b	18ZA03B	SPINDLE D13 - HITACHI 981-667
4	18ZA04	RETAINING RING (10) - HITACHI 939-556
5	18ZA05	BALL BEARING - HITACHI 620-2VV
6	18ZA06	RETAINING RING (10) - HITACHI 939-544
7	18ZA07	TAPPING SCREW - HITACHI 957-725
8	18ZA08	M5 SPRING WASHER (10) - HITACHI 949-454
9	18ZA09	GEAR COVER - HITACHI 981-650
10	18ZA10	FINAL GEAR - HITACHI 983-448
11	18ZA11	BALL BEARING - HITACHI 627-VVM
12	18ZA12	SECOND PINION - HITACHI 981-652Z
13	18ZA13	M8 WASHER (10) - HITACHI 949-426
14	18ZA14	BALL BEARING - HITACHI 608-VVM
15	18ZA15	INNER COVER ASSEMBLY - HITACHI 982-791
16	18ZA16	WASHER - HITACHI 984-357
17	18ZA16	WASHER - HITACHI 984-357
18	18ZA18J	ARMATURE - 110V - HITACHI 981-657J
-	18ZA18	ARMATURE - 230V - HITACHI 981-657
19	18ZA19	FAN GUIDE - HITACHI 981-562
21	18ZA21	TAPPING SCREW - HITACHI 931-875
22	18ZA22	TAPPING SCREW - HITACHI 981-561
23	18ZA23J	FIELD COIL - 110V - HITACHI 982-797J
-	18ZA23	FIELD COIL - 230V - HITACHI 982-797
24	18ZA24	WASHER (C) - HITACHI 984-367
25	18ZA25	BEARING LOCK - HITACHI 946-362
26	18ZA26	BRUSH TERMINAL - HITACHI N/A
27	18ZA27	BRUSH TERMINAL - HITACHI 982-801Z
28a	18ZA28A	HOUSING ASSEMBLY - HITACHI 982-790Z
29	18ZA29	SIDE HANDLE FOR M10 - HITACHI 981-205

Item	Part Number	Description
30	18ZA30	BRUSH CAP - HITACHI 961-781
31	18ZA31	SET CARBON BRUSHES - HITACHI 999-073
33	18ZA33	BRUSH HOLDER - HITACHI 981-586
34a	18ZA34A	HEX SOCKET SET SCREW - HITACHI 985-114
36	18ZA36	D-TYPE HANDLE - HITACHI 982-794Z
37	18ZA37	M10 SPECIAL BOLT - HITACHI 983-796Z
38	18ZA38	TAPPING SCREW - HITACHI 937-807
39	18ZA39	M5 WASHER (10) - HITACHI 949-424
40	18ZA40	HANDLE (B) - HITACHI 984-361
41	18ZA31	SET CARBON BRUSHES - HITACHI 999-073
42	18ZA42	SWITCH (2P PILLAR) - HITACHI 971-667Z
43	18ZA43	TUBE (D) - HITACHI 981-373
44	18ZA44	PILLAR TERMINAL - HITACHI 982-804Z
45	18ZA45	PILLER TERMINAL (B) - HITACHI 982-805Z
46	18ZA46	REVERSING SWITCH ASSEMBLY - HITACHI 982-802Z
47	18ZA47	HANDLE (A) - HITACHI 984-360
48	18ZA48	TAPPING SCREW (W/W) D4 X 20 - HITACHI 982-095
49	18ZA49	SUPPORT (B) - HITACHI 930-153
51	18ZA51	TAPPING SCREW - HITACHI 930-446
52	18ZA52	TUBE (D) - HITACHI 981-373
53	18ZA53	TERMINAL 50061 (10) - HITACHI 959-146
54	18ZA54	CORD CLIP - HITACHI 960-266
55	18ZA55	HITACHI LABEL - HITACHI 957-561
56	18ZA56	CORD ARMOUR (D8.8) - HITACHI 953-327
57	18ZA57	CORD - HITACHI 500-231Z
58	18ZA58	SPECIAL SCREW - HITACHI 981-122
	18X305	COMPLETE HITACHI D13 MOTOR UNIT - 110V
	18X306	COMPLETE HITACHI D13 MOTOR UNIT - 230V

## CE Declaration of Conformity

On our sole responsibility we declare that this product, the Powerbor PB32 Drill, is in conformity with the following standards and standard documents :-

- EN61029-1:2009 - Safety of Transportable Motor Operated Electric Tools
- EN61000-6-2:2005 - Electromagnetic Compatibility (EMC). Generic standards. Immunity standard for industrial environments
- EN61000-6-4:2007 - Electromagnetic compatibility (EMC). Generic standards. Emission standard for industrial environments

According to the regulations :-

- 2006/95/EC - Low Voltage Directive
- 2004/108/EC - EMC Directive
- 2006/42/EC - Machinery Directive
- 2011/65/EU - RoHS Directive (RoHS2)

Signed   
(P.D. Edwards - Managing Director)

Date....29.03.11

G&J Hall Ltd.  
Burgess Road  
SHEFFIELD  
S9 3WD  
England  
United Kingdom

Phone: +44 114 244 0562  
Fax: +44 114 244 9256  
Email: info@gjhall.co.uk  
Web: www.gjhall.co.uk

### WARRANTY REGISTRATION

Thank you for purchasing your Powerbor® magnetic based drilling machine, to ensure any warranty claim can be processed promptly, please register now at :-

<http://www.gjhall.co.uk>

Click on the button on the left "POWERBOR WARRANTY REG"

